



SIA *R & D AKUSTIKA*

LATVIJAS REPUBLIKA, LV - 1067, RĪGA, KURZEMES PROSPEKTS 3, Reģistr. Nr.: LV 010310045
Fax. +371 67815008, ☎ 371 67815007 mob. ☎ +371 29217605, E-mail: rd.akustika@apollo.lv

CUSTOMER: "CEWOOD" SIA (Latvia)


"CONFIRM"
Chairmen of board "R & D Akustika" Ltd.

_____/ J. SAPROVSKIS /

December 09, 2016.

**Cemented wood wool panels sound
absorption coefficient testing report**

No 806 / 2016 – AL 8.4

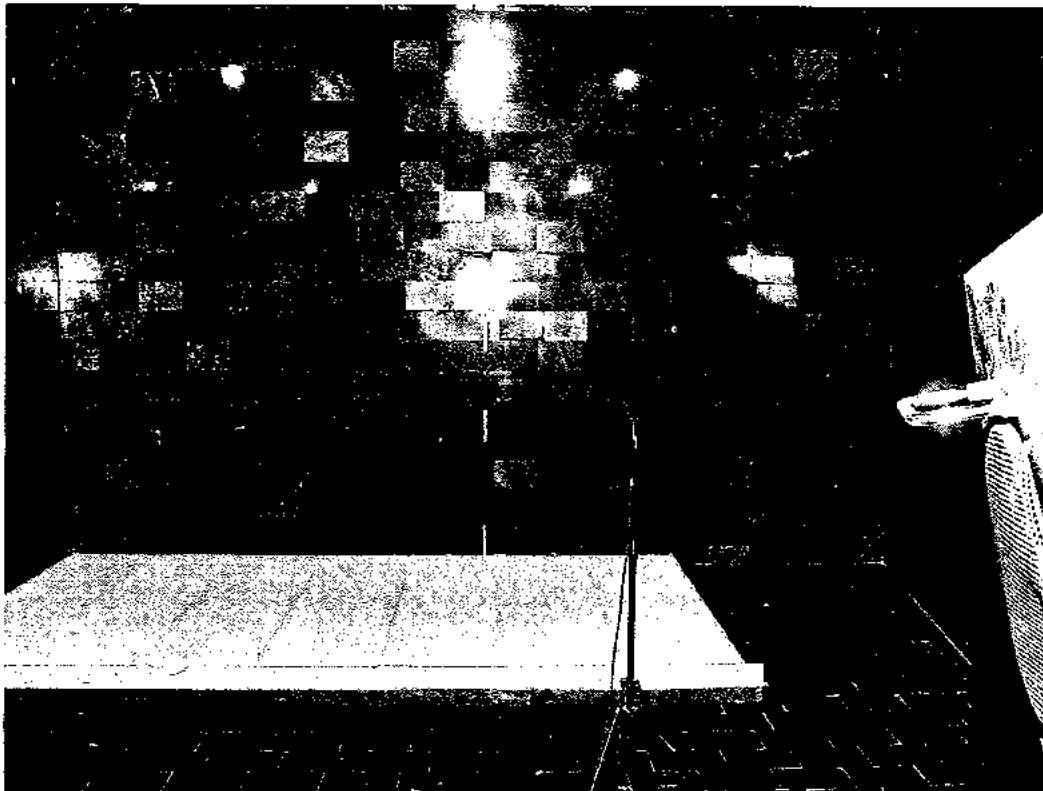

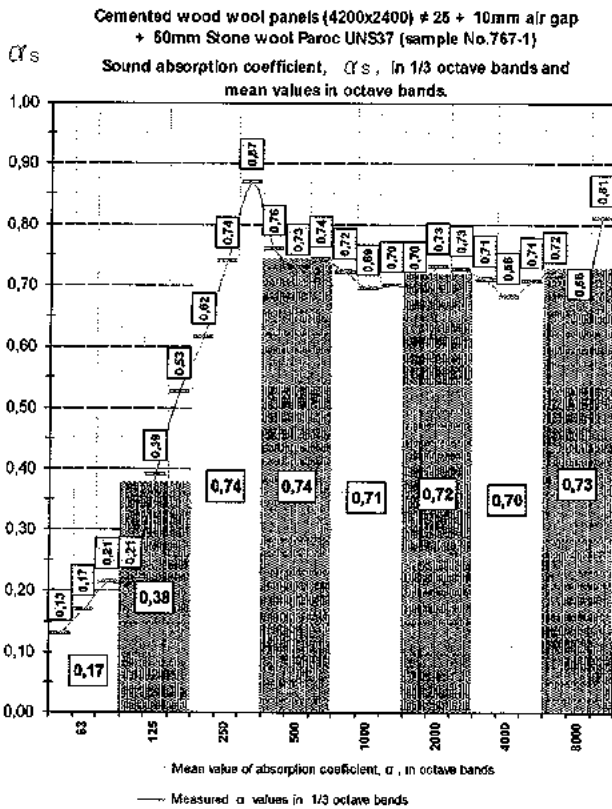


Fig. 13

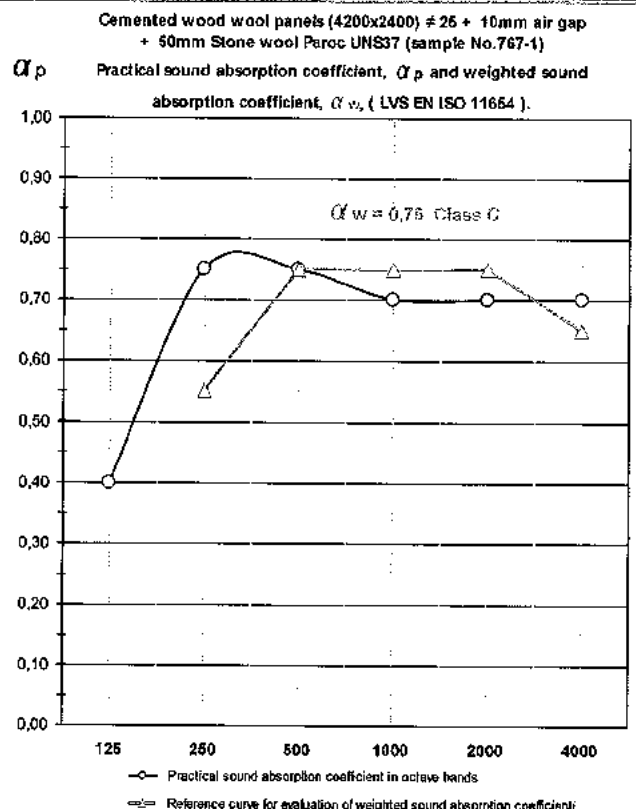


Fig. 14

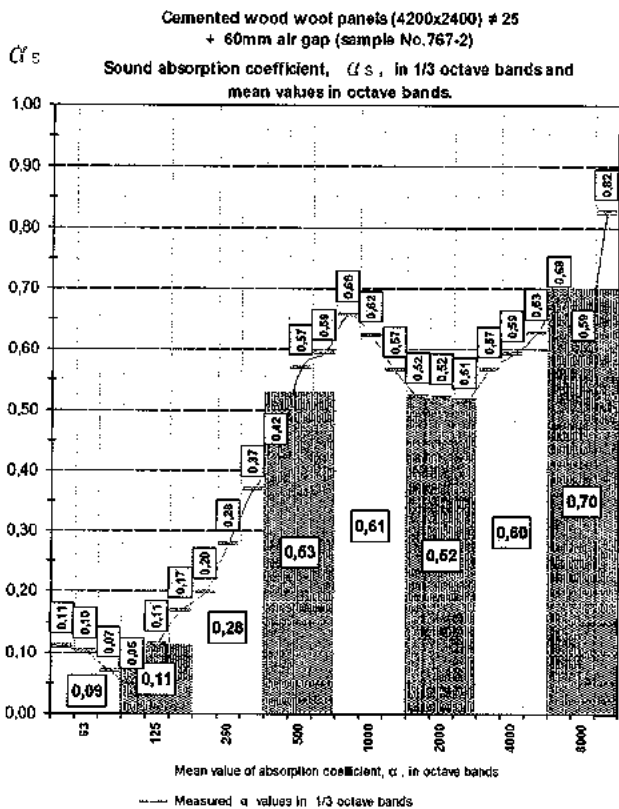


Fig. 15

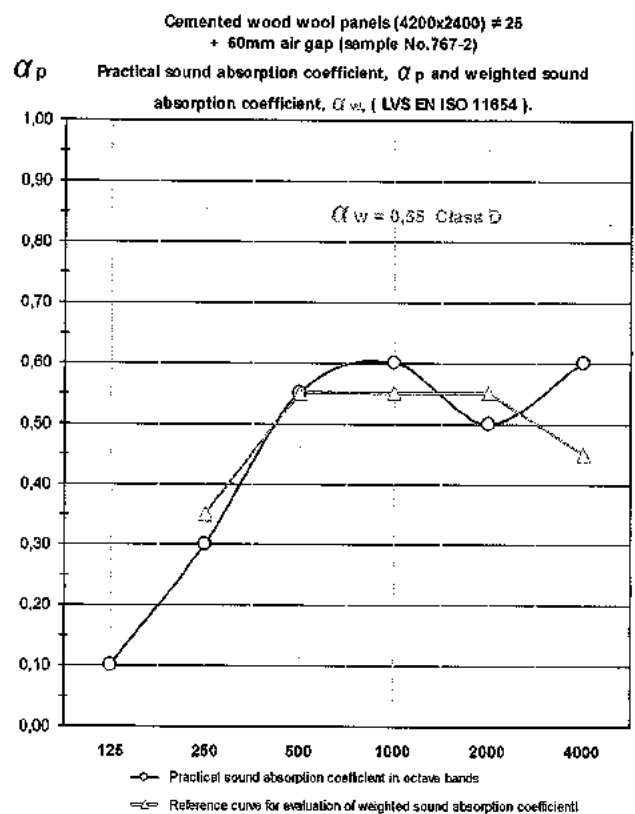


Fig. 16

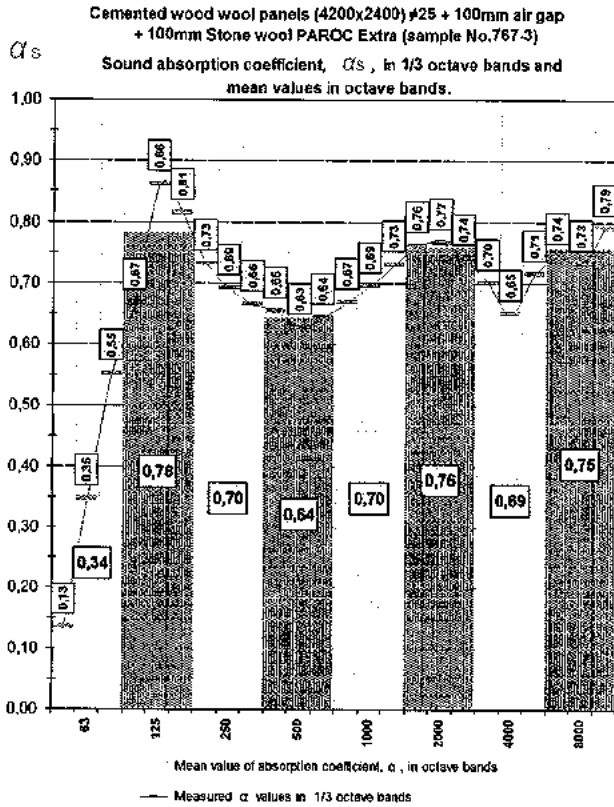


Fig. 17

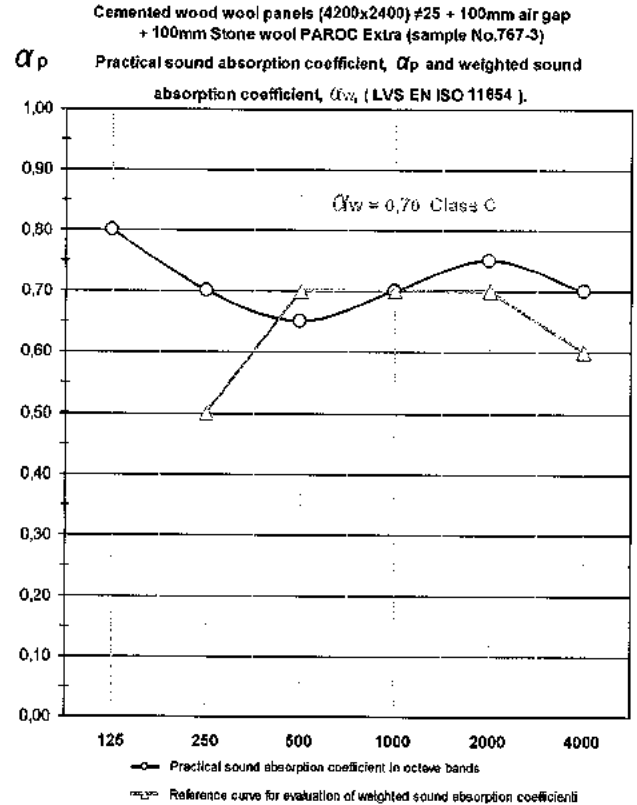


Fig. 18

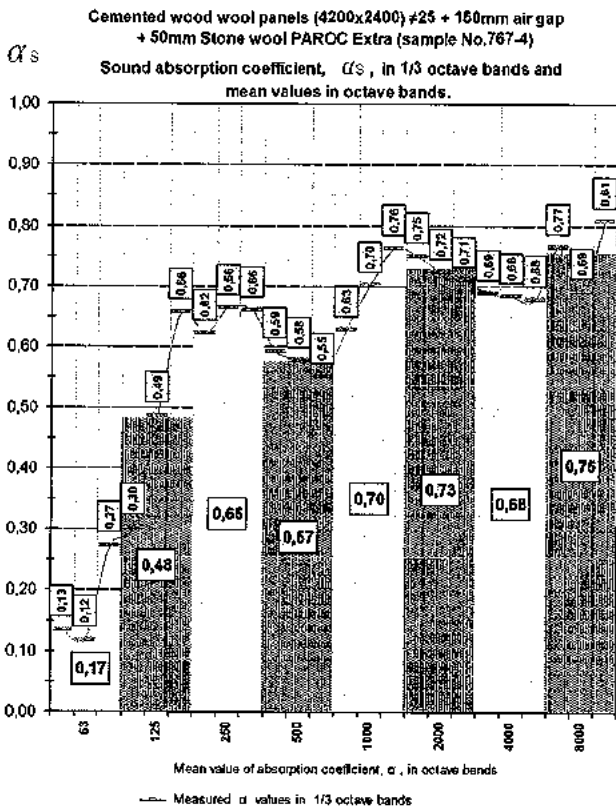


Fig. 19

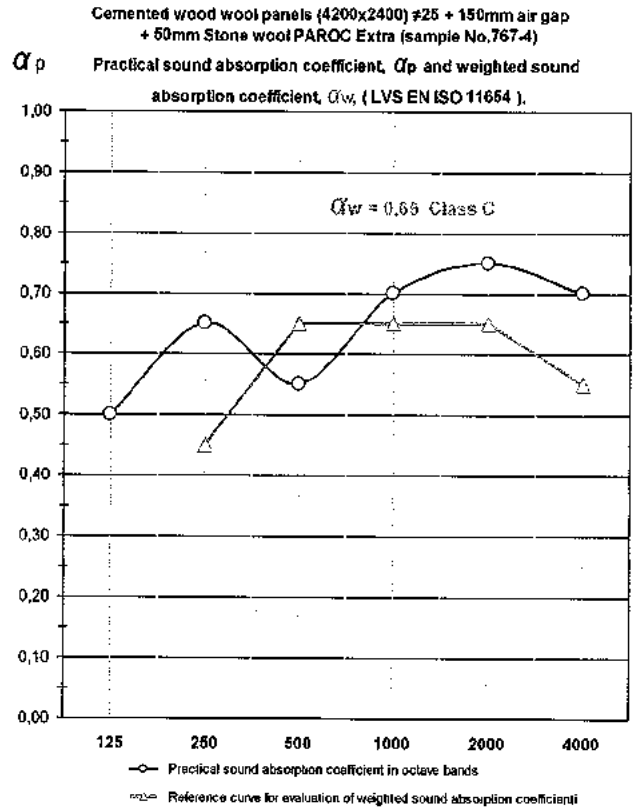


Fig. 20

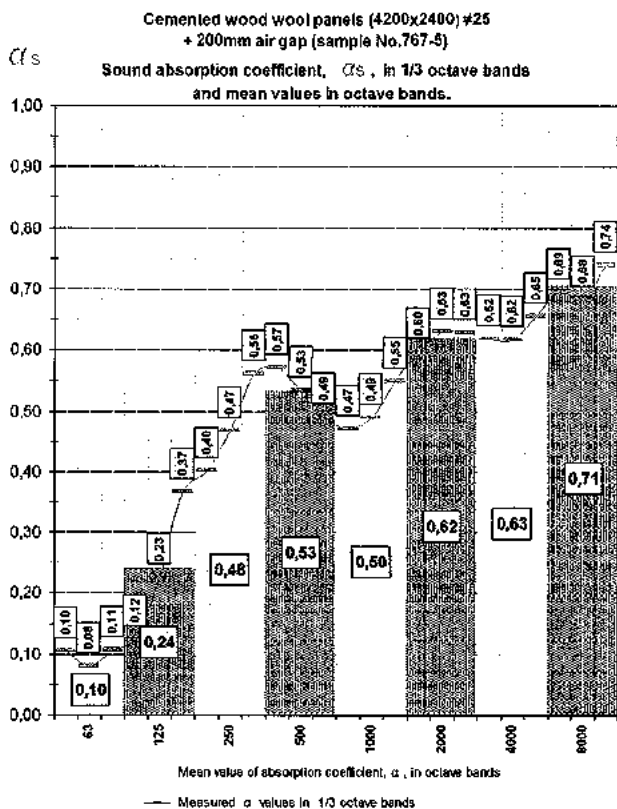


Fig. 21

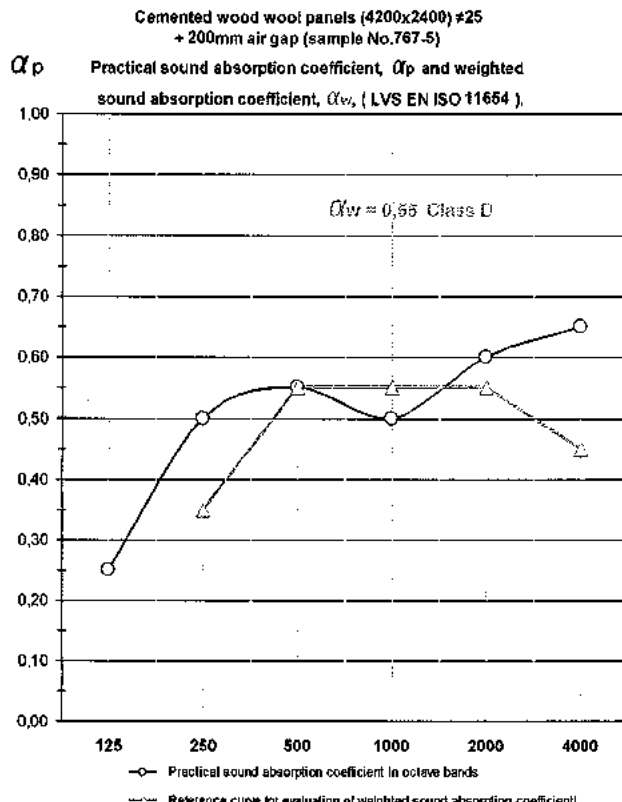


Fig. 22

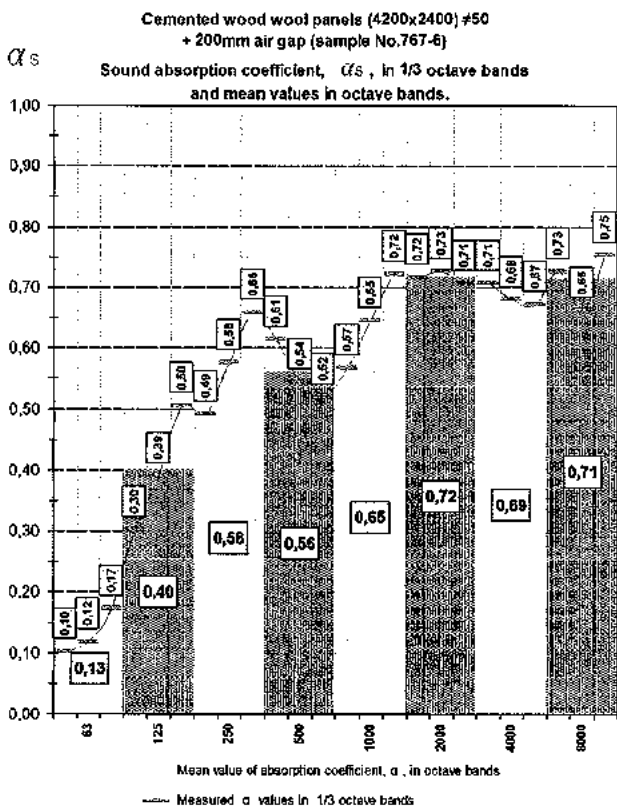


Fig. 23

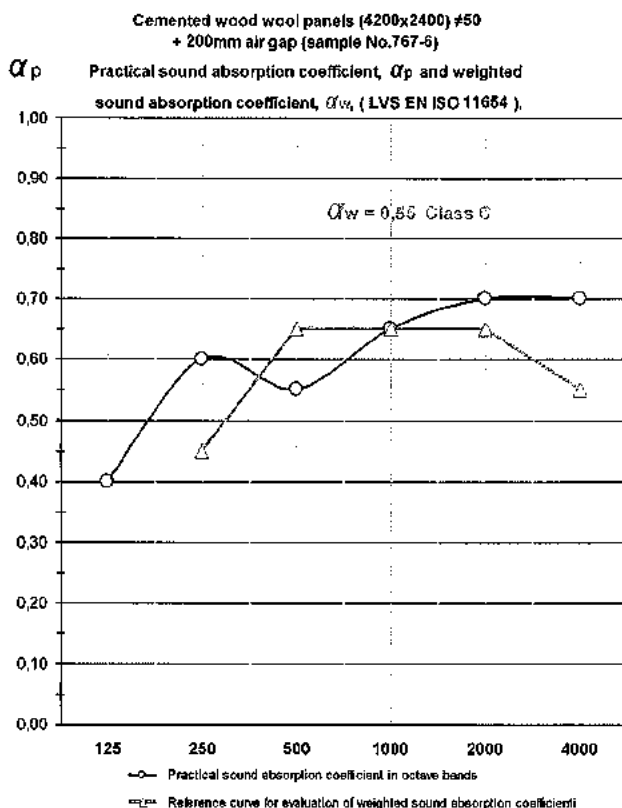


Fig. 24


Sound absorption coefficient α_s LVS EN ISO 354:2003.
Acoustics - Sound absorption measurements in reverberation room.
Practical α_p LVS EN ISO 11654. Acoustics - Sound absorbers in buildings - Rating of sound absorption.

Customer :	"CEWOOD" Ltd., "Gaidusalas-1", Jaunlaicene parish, Aluksne region, LV-4336	Sample Nr.:	767-1	Measurement date:	15.11.2016
-------------------	--	--------------------	--------------	--------------------------	------------

Description of measured construction and assembly:	Cemented wood wool panels (4200x2400) #25 + 10mm air gap + + 50mm Stone wool Paroc UNS37 + CD profile 27x60 (3,3 m/m ²). Surface specific mass 14,8 kg/m ² . Total area 10,08 m ²
---	---

Average climatic conditions in reverberation chamber.				Measurement conditions	
Temperature :	17,0	T [C°]	Reverberation chamber volume m ³ :	203	
Air pressure :	101,2	P [kPa]	Number of measurement points :	5	
Speed of sound in the air :	341,6	c [m/s]	Dodecahedron sound source positions :	1	
Relative air humidity :	59%	h [%]	Used type of signal :	MLS signal	

Frequency <i>f</i>	α_s ½ oct	α_p 1 oct
[Hz]	[dB]	[dB]
50	-	-
63	-	-
80	-	-
100	0,21	-
125	0,39	0,40
160	0,53	-
200	0,62	-
250	0,74	0,75
315	0,87	-
400	0,76	-
500	0,73	0,75
630	0,74	-
800	0,72	-
1000	0,69	0,70
1250	0,70	-
1600	0,70	-
2000	0,73	0,70
2500	0,73	-
3150	0,71	-
4000	0,68	0,70
5000	0,71	-
6300	-	-
8000	-	-
10000	-	-

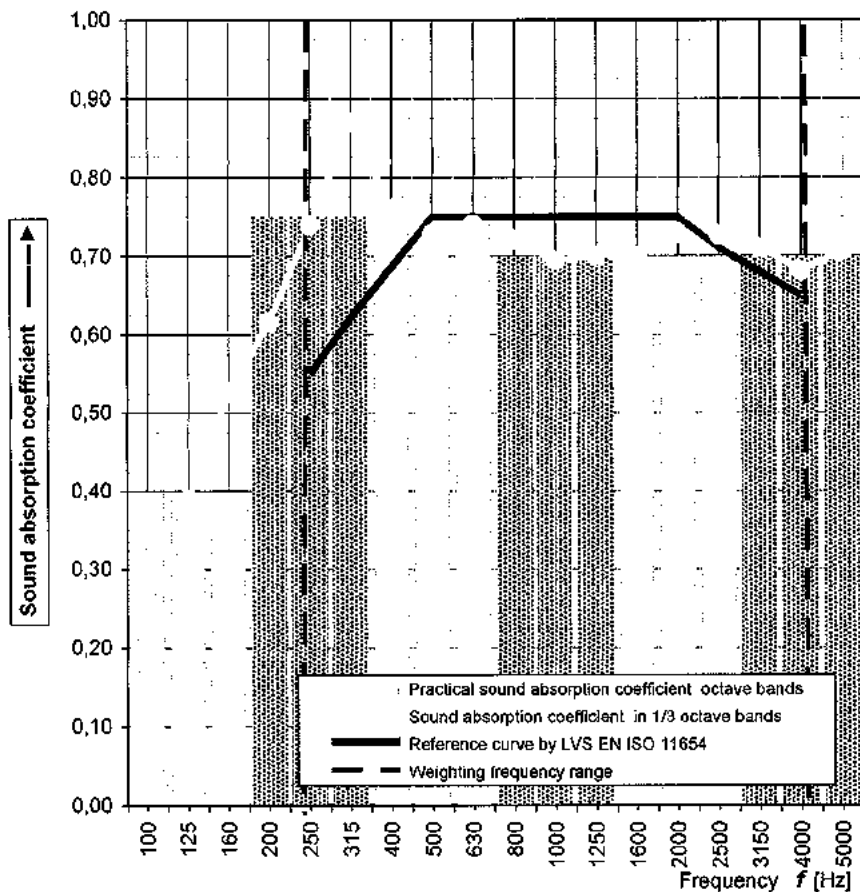

Practical sound absorption coefficient according to	LVS EN ISO 11654,	α_w :	0,75
Sound absorption class according to	LVS EN ISO 11654	:	C

Measurements done by: "R&D Akustika" Ltd. Acoustics laboratory T-282

By validity level 90% the measurement error is <5%

Operators signature : _____ / G.Kozlovskis/



Latvian National
Accreditation Bureau
(LATAK)

Annex of Testing report Nr. 806/2016-AL8.4


Sound absorption coefficient α_s LVS EN ISO 354:2003.
Acoustics - Sound absorption measurements in reverberation room.
Practical α_p LVS EN ISO 11654. Acoustics - Sound absorbers in buildings - Rating of sound absorption.

Custo-mer :	"CEWOOD" Ltd., "Galdusalas-1", Jaunlaicene parish, Aluksne region, LV-4336	Sample Nr.:	767-2	Measurement date:	15.11.2016
--------------------	--	--------------------	--------------	--------------------------	------------

Description of measured construction and assembly:	Cemented wood wool panels (4200x2400) #25 + 60mm air gap + + CD profile 27x60 (3,3 m/m ²). Surface specific mass 13,2 kg/m ² . Total area 10,08 m ²
---	---

Average climatic conditions in reverberation chamber.				Measurement conditions	
Temperature :	17,0	T [C°]	Reverberation chamber volume m ³ :	203	
Air pressure :	101,1	P [kPa]	Number of measurement points :	5	
Speed of sound in the air :	341,6	c [m/s]	Dodecahedron sound source positions :	1	
Relative air humidity :	56%	h [%]	Used type of signal :	MLS signal	

Frequency <i>f</i>	α_s 1/2 oct	α_p 1 oct
[Hz]	[dB]	[dB]
50	-	-
63	-	-
80	-	-
100	0,05	-
125	0,11	0,10
160	0,17	-
200	0,20	0,30
250	0,28	-
315	0,37	-
400	0,42	-
500	0,57	0,55
630	0,59	-
800	0,66	-
1000	0,62	0,60
1250	0,57	-
1600	0,52	-
2000	0,52	0,50
2500	0,51	-
3150	0,57	-
4000	0,59	0,60
5000	0,63	-
6300	-	-
8000	-	-
10000	-	-

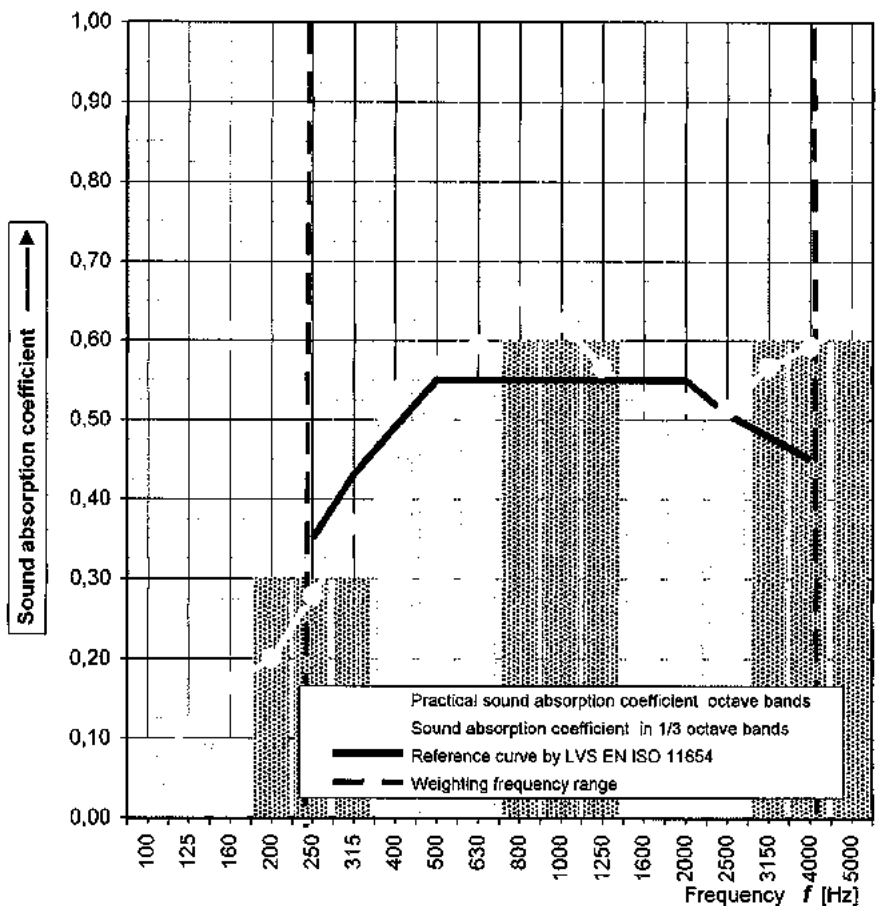

Practical sound absorption coefficient according to	LVS EN ISO 11654,	α_w :	0,55
Sound absorption class according to	LVS EN ISO 11654	:	D

Measurements done by: "R&D Akustika" Ltd. Acoustics laboratory T-282

By validity level 90% the measurement error is <5%

Operators signature : _____ / G.Kozlovskis/



Latvian National
Accreditation Bureau
(LATAK)

Annex of Testing report Nr. 806/2016-AL8.4


Sound absorption coefficient α_s LVS EN ISO 354:2003.
Acoustics - Sound absorption measurements in reverberation room.
Practical α_p LVS EN ISO 11654. Acoustics - Sound absorbers in buildings - Rating of sound absorption.

Custo-mer :	"CEWOOD" SIA, "Galdusalas-1", Jaunlaicenes pagasts, Alūksnes novads, LV-4336, Latvia	Sample Nr.: 767-3	Measurement date: 16.11.2016
	Description of measured construction and assembly: Cemented wood wool panels (4200x2400) #25 + 100mm air gap + 100mm Stone wool PAROC Extra + CD profile 27x60 (3,3 m/m ²). Surface specific mass 16,4 kg/m ² . Total area 10,08 m ²		

Average climatic conditions in reverberation chamber.		Measurement conditions	
Temperature :	17,0	T [C°]	Reverberation chamber volume m ³ :
Air pressure :	101,2	P [kPa]	Number of measurement points :
Speed of sound in the air :	341,6	c [m/s]	Dodecahedron sound source positions :
Relative air humidity :	64%	h [%]	Used type of signal :

Temperature :	17,0	T [C°]	Reverberation chamber volume m ³ :	203
Air pressure :	101,2	P [kPa]	Number of measurement points :	5
Speed of sound in the air :	341,6	c [m/s]	Dodecahedron sound source positions :	1
Relative air humidity :	64%	h [%]	Used type of signal :	MLS signal

Frequency f [Hz]	α_s % oct [dB]	α_p 1 oct [dB]
50	-	-
63	-	-
80	-	-
100	0,67	-
125	0,86	0,80
160	0,81	-
200	0,73	-
250	0,69	0,70
315	0,66	-
400	0,65	-
500	0,63	0,65
630	0,64	-
800	0,67	-
1000	0,69	0,70
1250	0,73	-
1600	0,76	-
2000	0,77	0,75
2500	0,74	-
3150	0,70	-
4000	0,65	0,70
5000	0,71	-
6300	-	-
8000	-	-
10000	-	-

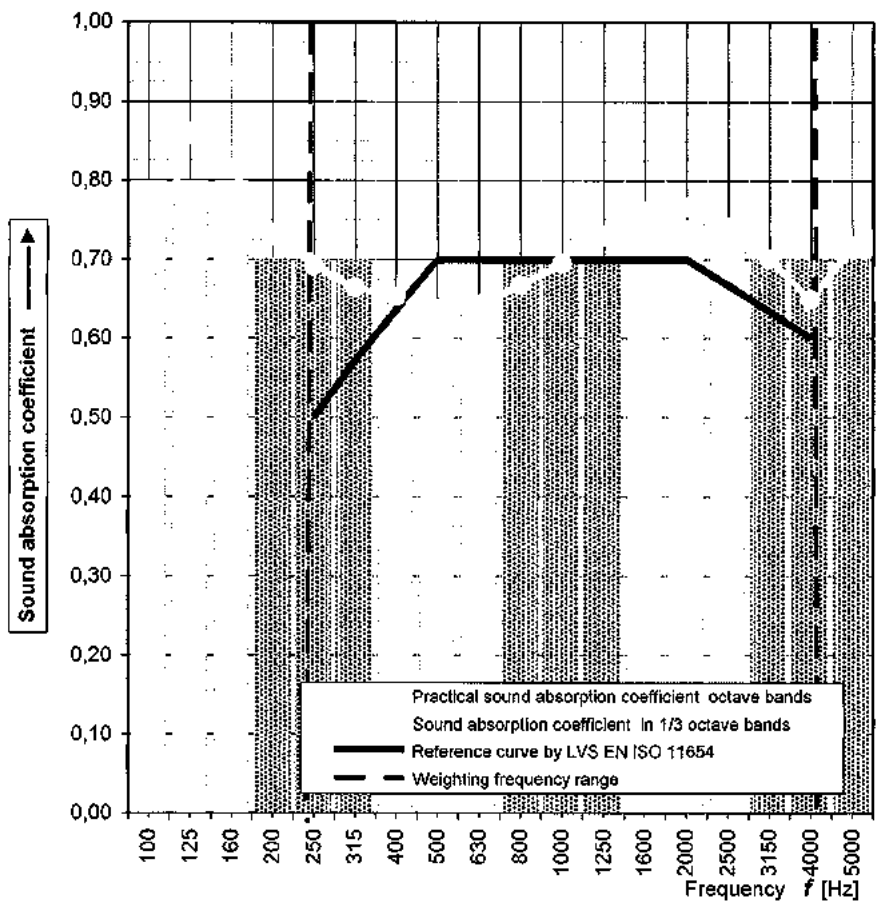

Practical sound absorption coefficient according to LVS EN ISO 11654,	α_w :	0,70
Sound absorption class according to LVS EN ISO 11654	:	C

Measurements done by: "R&D Akustika" Ltd. Acoustics laboratory T-282

By validity level 90% the measurement error is <5%

Operators signature : _____ / G.Kozlovskis/



Latvian National Accreditation Bureau (LATAK)

Annex of Testing report Nr. 806/2016-AL8.4


Sound absorption coefficient α_s LVS EN ISO 354:2003.
Acoustics - Sound absorption measurements in reverberation room.
Practical α_p LVS EN ISO 11654. Acoustics - Sound absorbers in buildings - Rating of sound absorption.

Customer :	"CEWOOD" SIA, "Galdusalas-1", Jaunlaicenes pagasts, Alūksnes novads, LV-4336, Latvia	Sample Nr.:	767-4	Measurement date:	16.11.2016
-------------------	--	--------------------	--------------	--------------------------	------------

Description of measured construction and assembly:	Cemented wood wool panels (4200x2400) #25 + 150mm air gap + + 50mm Stone wool PAROC Extra + CD profile 27x60 (3,3 m/m ²). Surface specific mass 14,8 kg/m ² . Total area 10,08 m ²
---	--

Average climatic conditions in reverberation chamber.				Measurement conditions	
Temperature :	17,0	T [C°]	Reverberation chamber volume m ³ :	203	
Air pressure :	101,2	P [kPa]	Number of measurement points :	5	
Speed of sound in the air :	341,6	c [m/s]	Dodecahedron sound source positions :	1	
Relative air humidity :	64%	h [%]	Used type of signal :	MLS signal	

Frequency <i>f</i>	α_s 1/2 oct	α_p 1 oct
[Hz]	[dB]	[dB]
50	-	-
63	-	-
80	-	-
100	0,30	-
125	0,49	0,50
160	0,66	-
200	0,62	-
250	0,66	0,65
315	0,66	-
400	0,59	-
500	0,58	0,55
630	0,55	-
800	0,63	-
1000	0,70	0,70
1250	0,76	-
1600	0,75	-
2000	0,72	0,75
2500	0,71	-
3150	0,69	-
4000	0,68	0,70
5000	0,68	-
6300	-	-
8000	-	-
10000	-	-

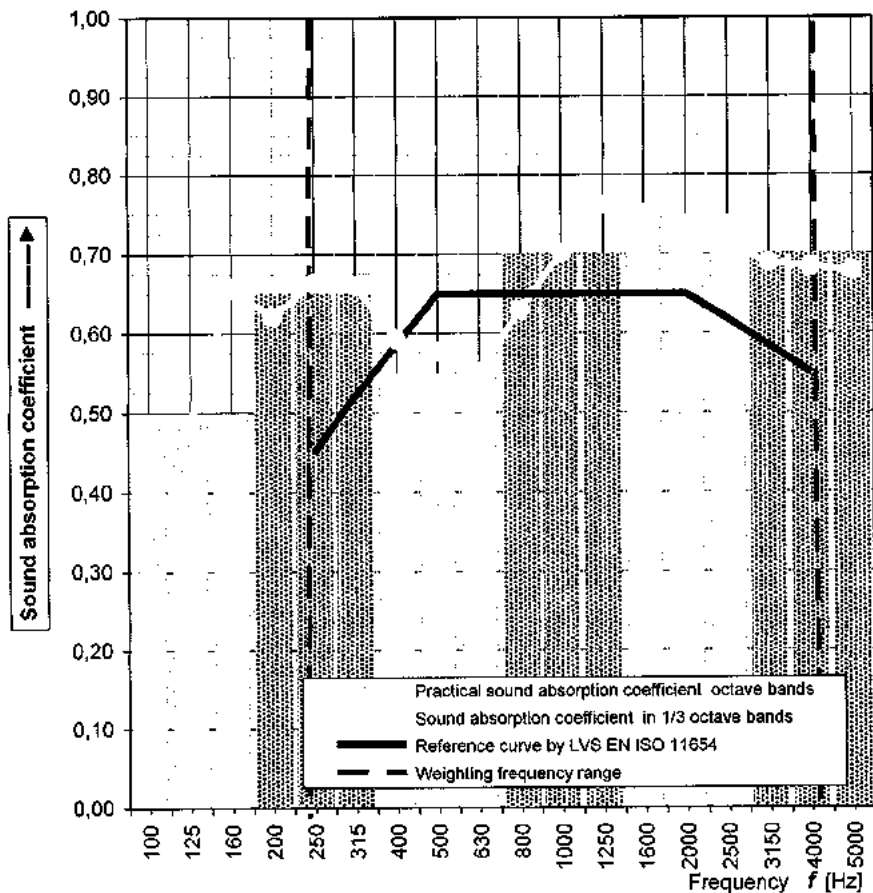

Practical sound absorption coefficient according to	LVS EN ISO 11654,	α_w :	0,65
Sound absorption class according to	LVS EN ISO 11654	:	C

Measurements done by: "R&D Akustika" Ltd. Acoustics laboratory T-282

By validity level 90% the measurement error is <5%

Operators signature : _____ / G.Kozlovskis/



Latvian National
Accreditation Bureau
(LATPAK)


Annex of Testing report Nr. 806/2016-AL8.4

Sound absorption coefficient α_s LVS EN ISO 354:2003.
Acoustics - Sound absorption measurements in reverberation room.
Practical α_p LVS EN ISO 11654. Acoustics - Sound absorbers in buildings - Rating of sound absorption.

Customer:	"CEWOOD" SIA, "Galdusalas-1", Jaunlaicenes pagasts, Alūksnes novads, LV-4336, Latvia	Sample Nr.: 767-5	Measurement date: 16.11.2016
	Description of measured construction and assembly: Cemented wood wool panels (4200x2400) #25 + 200mm air gap + + CD profile 27x60 (3,3 m/m ²). Surface specific mass 13,2 kg/m ² . Total area 10,08 m ²		

Average climatic conditions in reverberation chamber.				Measurement conditions	
Temperature:	17,0	T [C°]	Reverberation chamber volume m ³ :	203	
Air pressure:	101,1	P [kPa]	Number of measurement points:	5	
Speed of sound in the air:	341,6	c [m/s]	Dodecahedron sound source positions:	1	
Relative air humidity:	64%	h [%]	Used type of signal:	MLS signal	

Frequency <i>f</i>	α_s ½ oct	α_p 1 oct
[Hz]	[dB]	[dB]
50	-	-
63	-	-
80	-	-
100	0,12	-
125	0,23	0,25
160	0,37	-
200	0,40	0,50
250	0,47	0,50
315	0,56	0,55
400	0,57	0,55
500	0,53	0,55
630	0,49	0,50
800	0,47	0,50
1000	0,49	0,50
1250	0,55	0,60
1600	0,60	0,60
2000	0,63	0,60
2500	0,63	0,65
3150	0,62	0,65
4000	0,62	0,65
5000	0,65	0,65
6300	-	-
8000	-	-
10000	-	-

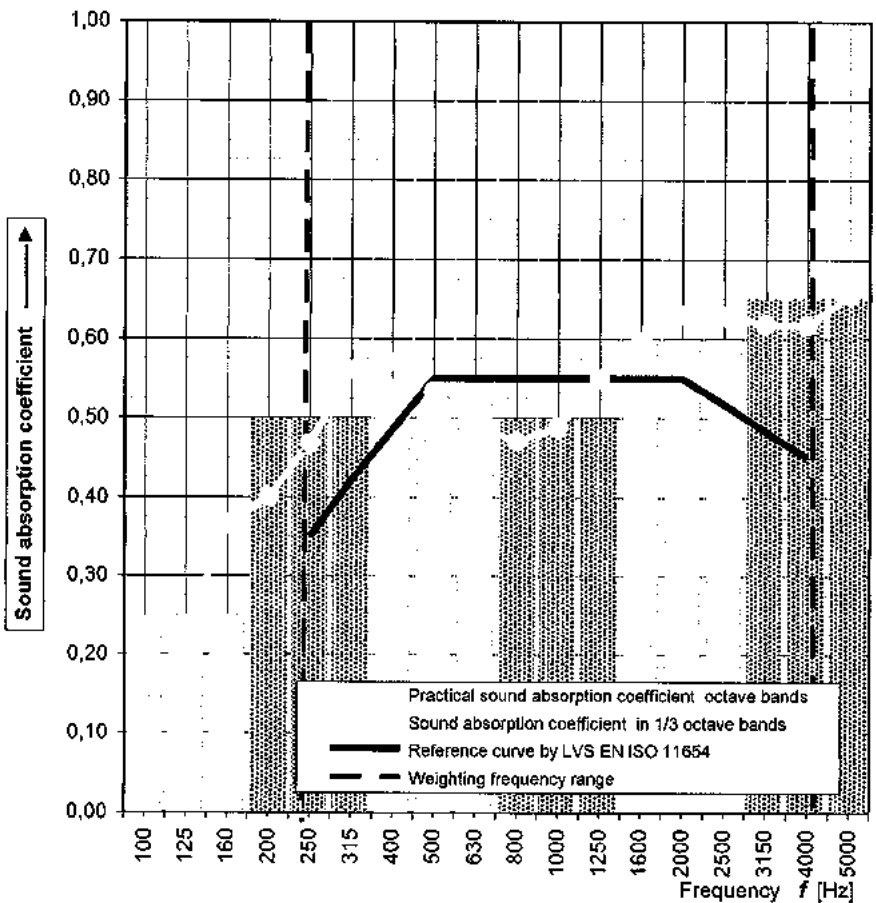

Practical sound absorption coefficient according to LVS EN ISO 11654,	α_w :	0,55
Sound absorption class according to LVS EN ISO 11654	:	D

Measurements done by: "R&D Akustika" Ltd. Acoustics laboratory T-282

By validity level 90% the measurement error is <5%

Operators signature : _____ / G.Kozlovskis/



Latvian National
Accreditation Bureau
(LATAK)

Annex of Testing report Nr. 806/2016-AL8.4


Sound absorption coefficient α_s LVS EN ISO 354:2003.
Acoustics - Sound absorption measurements in reverberation room.
Practical α_p LVS EN ISO 11654. Acoustics - Sound absorbers in buildings - Rating of sound absorption.

Customer :	"CEWOOD" SIA, "Galdusalas-1", Jaunlaicenes pagasts, Alūksnes novads, LV-4336, Latvia	Sample Nr.:	767-6	Measurement date:	16.11.2016
-------------------	--	--------------------	--------------	--------------------------	------------

Description of measured construction and assembly:	Cemented wood wool panels (4200x2400) #50 + 200mm air gap + + CD profile 27x60 (3,3 m/m ²). Surface specific mass 21,7 kg/m ² . Total area 10,08 m ²
---	--

Average climatic conditions in reverberation chamber.				Measurement conditions	
Temperature :	17,0	T [C°]	Reverberation chamber volume m ³ :	203	
Air pressure :	101,1	P [kPa]	Number of measurement points :	5	
Speed of sound in the air :	341,6	c [m/s]	Dodecahedron sound source positions :	1	
Relative air humidity :	64%	h [%]	Used type of signal :	MLS signal	

Frequency <i>f</i>	α_s % oct	α_p 1 oct
[Hz]	[dB]	[dB]
50	-	-
63	-	-
80	-	-
100	0,30	-
125	0,39	0,40
160	0,50	-
200	0,49	0,60
250	0,58	-
315	0,66	-
400	0,61	-
500	0,54	0,55
630	0,52	-
800	0,57	-
1000	0,65	0,65
1250	0,72	-
1600	0,72	-
2000	0,73	0,70
2500	0,71	-
3150	0,71	0,70
4000	0,68	-
5000	0,67	-
6300	-	-
8000	-	-
10000	-	-

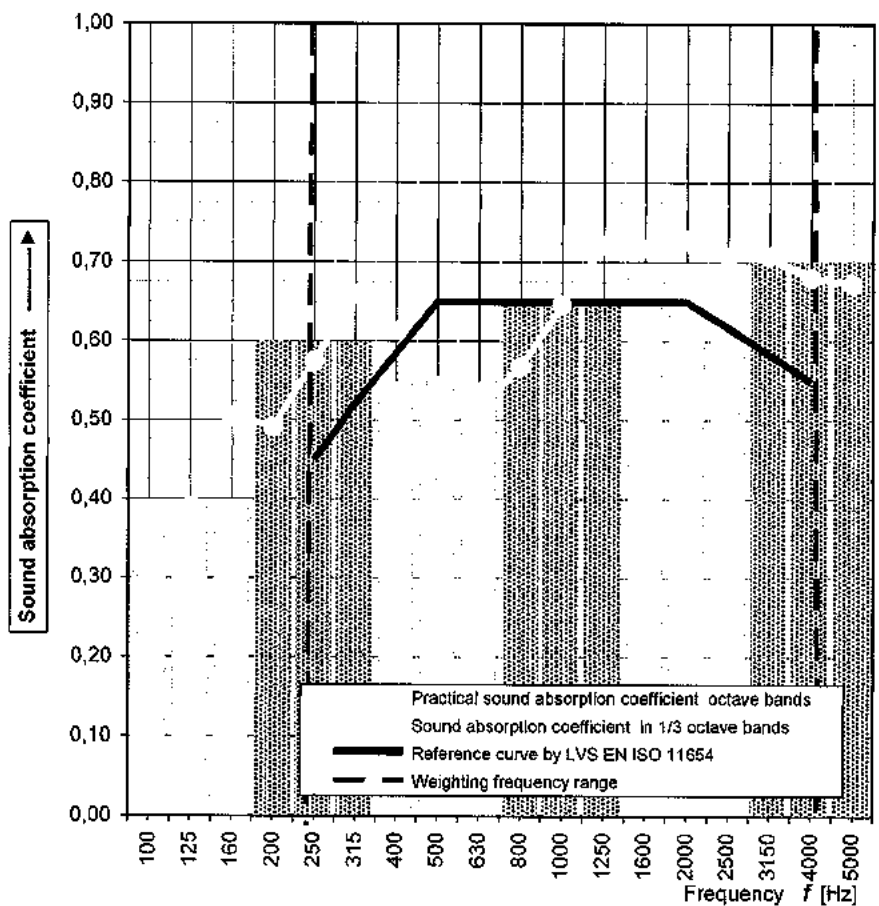

Practical sound absorption coefficient according to	LVS EN ISO 11654,	α_w :	0,65
Sound absorption class according to	LVS EN ISO 11654	:	C

Measurements done by: "R&D Akustika" Ltd. Acoustics laboratory T-282

By validity level 90% the measurement error is <5%

Operators signature : _____ / G.Kozlovskis/



Latvian National
Accreditation Bureau
(LATAK)

Annex of Testing report Nr. 806/2016-AL8.4